



## Service Bulletin

**Service Notice Number:** 2024-01

**To:** Authorized Atlas Dealers

**Date:** 2/9/24

**Subject:** Hazard & Turn Signal Light Flasher

---

### Problem:

The flasher in front dash storage tray, used to control the hazard & turn signal lights (see image below), may be sensitive to low amounts of current caused by moisture build-up inside the turn signal switch causing a continuous “clicking” noise.



After the turn signal switch dries out, the “clicking” will stop. However, this issue may return if the turn signal switch is exposed to large amounts of water from rain or washing.

### Solution:

Order part number **4.04.02.04.010 FLL302M 12V FLASHER WITH 10K RESISTOR** and replace existing flasher. The new flasher has a 10k resistor to dissipate residual current created by water intrusion in turn signal switch.

This is a **“fix-as-fail”** service notice. Do not replace all flashers.

**Warranty Time Allowed:** 15 minutes per car reworked. Submit warranty claim for parts and labor after rework.

Please distribute this service bulletin to all appropriate personnel at your dealership.

If you have any comments or questions, please contact Atlas at 833-872-8527 or e-mail [info@atlasarts.com](mailto:info@atlasarts.com).